

2025 Annual Drinking Water Quality Report (Consumer Confidence Report) Town of Holly Hill SCDES System # 3810002

We're pleased to present to you the 2025 Annual Drinking Water Quality Report for the Town of Holly Hill water system. This report is designed to inform you about the quality of water and the services we deliver to you every day. Our constant goal is to provide you with a safe and dependable supply of drinking water. We want you to understand the efforts we make to continually improve the water treatment process and protect our water resources. We are committed to ensuring the quality of your water. Our drinking water is produced from two (2) groundwater wells located in the Santee Limestone Aquifer and the Black Mingo Aquifer.

A Source Water Assessment Plan has also been prepared for our system. If you have any questions about this report, or concerning your water utility, please contact operator Stephen Noonan or Robert Luhrs and the Town of Holly Hill at (843) 496-3330. We want our valued customers to be informed about their water utility. If you want to learn more, please attend any of our regularly scheduled meetings on the second Tuesday of every month at 7:00 pm at the Holly Hill Town Hall.

The Town of Holly Hill routinely monitors contaminants in your drinking water according to Federal and State laws. The table below shows the results of our monitoring for the period of January 1st to December 31st, 2025. As water travels over the land or underground, it can pick up substances or contaminants such as microbes, inorganic and organic chemicals, and radioactive substances. All drinking water, including bottled drinking water, may be reasonably expected to contain at least small amounts of some contaminants. It's important to remember that the presence of these contaminants does not necessarily pose a health risk.

In the following table you will find terms and abbreviations that you might not be familiar with. To help you better understand these terms we've provided the following definitions:

- **Non-Detects (ND)** - laboratory analysis indicates that the constituent is not present.
- **Not Applicable** - (NA)
- **Maximum Contaminant Level Goal** - the "Goal" (MCLG) is the level of a contaminant in drinking water below that there is no known or expected risk to health. MCLGs allow for a margin of safety.
- **Maximum Contaminant Level** - the "Maximum Allowed" (MCL) is the highest level of a contaminant that is allowed in drinking water. MCLs are set as close to the MCLGs as feasible using the best available treatment technology.
- **Action level (AL)** – the concentration of a contaminant which, if exceeded, triggers treatment or other requirements which a water system must follow.
- **Parts per billion (ppb)** or Micrograms per liter – one part per billion corresponds to one ounce in 7,350,000 gallons of water, or one minute in 2,000 years, or a single penny in \$10,000,000.
- **Parts per million (ppm)** - one part per million corresponds to one ounce in 7,350 gallons of water, or one minute in two years, or a single penny in \$10,000.
- **Running Annual Average (RAA)** – Regulatory compliance with some MCLs are based on running annual average of monthly samples.
- **Maximum Residual Disinfectant Level (MRDL)** – The highest level of a disinfectant allowed in drinking water. There is convincing evidence that addition of a disinfectant is necessary for control of microbial contaminants.
- **Maximum Residual Disinfectant Level Goal (MRDLG)** – The level of a drinking water disinfectant below which is no known or expected risk to health. MRDLGs do not reflect the benefits of the use of disinfectants to control microbial contaminants.

Town of Holly Hill – System # SC3810002



Lead and Copper Test Results

Contaminant Name	Year Sampled	MCLG	Action Level (AL)	90 th Percentile	Range of Results	# of Sites Over AL	Units	Violation (Y/N)	Likely Source of Contamination
Copper	2024	1.3	1.3	0.033	0.0029-0.033	0	ppm	N	Corrosion of household plumbing systems; Erosion of natural deposits; Leaching from wood preservatives
Lead	2024	0	15	0.0017	0.0-0.23	1	ppb	N	Corrosion of household plumbing systems; Erosion of natural deposits

Lead can cause serious health problems, especially for pregnant women and young children. Lead in drinking water is primarily from materials and components associated with service lines and home plumbing. The Town of Holly Hill SC#3180002 is responsible for providing high quality drinking water and removing lead pipes but cannot control the variety of materials used in plumbing components in your home. You share the responsibility for protecting yourself and your family from the lead in your home plumbing. You can take responsibility by identifying and removing lead materials within your home plumbing and taking steps to reduce your family's risk. Before drinking tap water, flush your pipes for several minutes by running your tap, taking a shower, doing laundry or a load of dishes. You can also use a filter certified by an American National Standards Institute accredited certifier to reduce lead in drinking water. If you are concerned about lead in your water and wish to have your water tested, contact Stephen Noonan and the Town of Holly Hill at (843) 496-3330. Information on lead in drinking water, testing methods, and steps you can take to minimize exposure is available at <http://www.epa.gov/safewater/lead>.

Town of Holly Hill– System # SC 3810002




Regulated Contaminants Test Results

Disinfectants and Disinfection By-Products	Collection Date	Highest Level Detected	Range of Levels Detected	MCLG	MCL	Units	Violation (Y/N)	Likely Source of Contamination
Chlorine	2025	1.0	0.14 - 0.75	MRDLG = 4	MRDL = 4	ppm	N	Water additive used to control microbes
Total Trihalomethanes [TTHM]	2025	13.834	na	No goal for the total	80	ppb	N	By-product of drinking water disinfection

Inorganic Contaminant Test Results

Contaminant Name	Collection Date	Highest Level Detected	Range of Levels Detected	MCLG	MCL	Units	Violation (Y/N)	Likely Source of Contamination
Fluoride	2023	0.42	na	4	4.0	ppm	N	Erosion of natural deposits; water additive which promotes strong teeth; discharge from fertilizer and aluminum factories
Sodium (unregulated contaminant)	2023	52	na	N/A	N/A	ppm	N	Erosion of natural deposits
Radioactive Contaminants	Collection Date	Highest Level Detected	Range of Levels Detected	MCLG	MCL	Units	Violation (Y/N)	Likely Source of Contamination

Combined Radium 226/228	2025	0.144	0.094-0.144	0	5	pCi/L	N	Erosion of natural deposits
-------------------------	------	-------	-------------	---	---	-------	---	-----------------------------

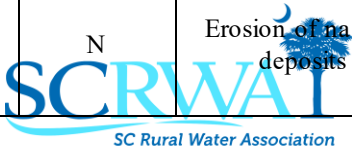

Town of Holly Hill (SC) **System Violations Table 3810002**

Revised Total Coliform Rule (RTCR)			
The RTCR seeks to prevent waterborne diseases caused by <i>E. coli</i> . <i>E. coli</i> are bacteria whose presence indicates that the water may be contaminated with human or animal wastes. Human pathogens in these wastes can cause short-term effects, such as diarrhea, cramps, nausea, headaches, or other symptoms. They may pose a greater health risk for infants, young children, the elderly, and people with severely compromised immune system s.			
Violations Type	Violation Begin	Violation End	Violation Explanation
REPORT SAMPLE RESULT/MONITORING RTCR	06/10/2026	06/15/2026	We failed to submit sample results in a timely manner.

Town of Holly Hill continues to monitor Drinking water for contamination; we are and remain well within compliance for safe drinking water. This violation was a result of untimely reporting not failed results or high results. We have reworked our reporting protocol to include a more robust system to ensure lab payments are completed on time. Feel free to contact Steve Noonan or Robert Luhrs with Town of Holly Hill 843-496-3330 with any questions or concerns.

Town of Holly Hill
8423 Old State rd
Holly Hill SC 29059

Other

1. Holly Hill completed a SCDES Drinking Water Sanitary Survey in The Fall of 2025 and was awarded a Satisfactory grade for Drinking Water performance.
2. Holly Hill per SCDES / EPA regulations completed the Lead and Copper Rule (LCRR). This is a program to try and determine how many, if any, lines in Town may have lead and or copper material. Holly Hill completed and submitted the survey in 2024. We continue in 2026 to identify and eliminate any pipes containing lead.
3. Source Water Protection plan can be found on SCDES website and from Orangeburg Regional office.

4. Holly Hill continues with the identification process for locating and documenting any lead containing water service lines within the town limits. We expect to be 100% by the end of 2026.

